


# TECHNICAL SERVICE BULLETIN

## *Replacing the High Temperature Cutout on Built-in Wall Ovens (Service Kit 617877)*

In some double 27" built-in wall ovens produced prior to March 2009, the lower oven high temperature cutout (HTC) may trip prematurely. The transfer of excessive heat to the cutout from the screws which fasten the HTC to the plenum (or to the HTC mounting bracket) has been identified as the cause. If this occurs, replace the lower oven HTC and mounting screws with the new HTC and screws included in this service kit.


**TO ENSURE PROPER OPERATION, ALL PARTS IN THIS KIT MUST BE INSTALLED.**

Mounting HTC to plenum

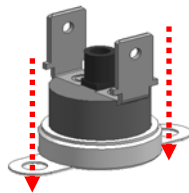

or

Mounting HTC to mounting bracket

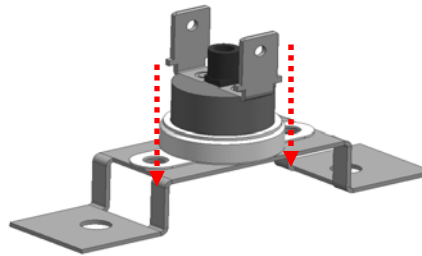

The 27" models which **require** the kit for the lower oven are highlighted in the table below. The kit may also be used as the HTC service replacement for the 27" upper ovens and all other models reflected in the table.

DM301ES	HBL57x0UC	<b>ME272ES</b>	MEW301ES	PODC302
DM302ES	HBL8x50UC	<b>MED272Ex</b>	MEM301ES	PODM301
HB30D51UC	HBN3350UC	MEM271Ex	MEMC301Ex	PODMW301
HB30S51UC	HBN34x0UC	MEMCW271ES	MEMW301ES	POM301
HBL33x0UC	<b>HBN35x0UC</b>	MEMW271Ex	MEMCW301Ex	POMW301
HBL34x0UC	HBN54x0UC	M301ES	PO301	
HBL35x0UC	<b>HBN56x0UC</b>	ME301Ex	PO302	
HBL54x0UC	M271ES	ME302Ex	POD301	
HBL56x0UC	ME271Ex	MED302Ex	POD302	

For additional assistance, please contact our Technical Support Team at 800 444-9091.

Visit *QuickFinder* at <http://portal.mch.bshg.com/portal>.